


Product Features / 產品特性

<b>Operating Temperature</b> 操作溫度	Operating temperature / 操作溫度範圍：-55°C~125°C When choosing the fuses specification, if the operating environmental temperature beyond the scope from 20~30°C, you should consider the environmental temperature's affection to fuses. 若貴司操作環境溫度超出25±5°C範圍，在選用保險絲規格時，需考慮操作環境溫度對保險絲的影響。
<b>Storage Conditions</b> 儲存條件	Under airtight in temperature +10°C~60°C、relative humidity ≤75% can store 3 years. 在溫度+10°C~60°C、相對濕度≤75%的密閉條件下可存放3年。 Without dew in temperature+10°C~60°C、relative humidity be 95% maximum value for 30 days. 在溫度+10°C~60°C、相對濕度為95%的非露天下最多可存放30天。
<b>Installation Way &amp; Parameters</b> 安裝方式及條件	Stud-mount / 螺絲安裝 Wave soldering parameters / 波峰焊 Solder pot temperature / 錫爐溫度：260±3°C Max Solder dwell time / 焊接時間：10s Max Hand welding parameters / 手工焊 Solder iron temperature / 烙鐵溫度：350±5°C Heating time / 焊接時間：5s Max



Dimensions / 尺寸圖 (Unit / 單位:mm)

WHFM-XXX

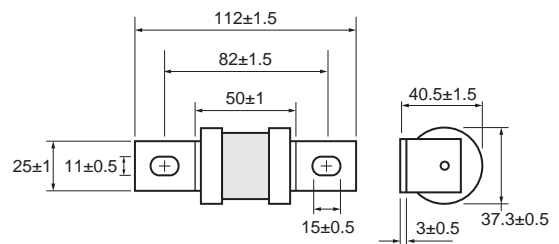

Electrical Characteristics / 電氣特性

Type 品名	Ordering P / N 料號	Rated Current 額定電流	Breaking Capacity 分斷能力	Safety Approvals 安全認證
WHFM	WHFM-XXX			
	WHFM-180	180A	690VAC / 50KA 500VDC / 10KA	●
	WHFM-200	200A		●
	WHFM-225	225A		●
	WHFM-250	250A		●
	WHFM-280	280A		●
	WHFM-315	315A		●
WHFM-350	350A	●		